DEPARTMENT OF HEALTH AND H PRINTED: 08/08/2011 **N SERVICES** FORM APPROVED CENTERS FOR MEDICARE & MEDICAID SERVICES OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING 445047 08/01/2011 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 306 W DUE WEST AVE IMPERIAL GARDENS HEALTH AND REHABILITATION MADISON, TN 37115 SUMMARY STATEMENT OF DEFICIENCIES (X4) 1D ID PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (X5) PREFIX (EACH CORRECTIVE ACTION SHOULD BE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) COMPLETION TAG CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY) NFPA 101 LIFE SAFETY CODE STANDARD K 018 K 018 K 018 SS=D On 8/1/2011 the basement stairway Doors protecting corridor openings in other than door closure was adjusted by the required enclosures of vertical openings, exits, or Maintenance Manager and it now hazardous areas are substantial doors, such as closes. those constructed of 1% inch solid-bonded core wood, or capable of resisting fire for at least 20 The Door will be monitored by the minutes. Doors in sprinklered buildings are only required to resist the passage of smoke. There is Maintenance Manager weekly X 4 then no impediment to the closing of the doors. Doors monthly X 3 for proper closure. are provided with a means suitable for keeping (Attachment 15) the door closed. Dutch doors meeting 19.3.6.3.6 are permitted. 19.3.6.3 Results will be reviewed in the monthly QI meeting for oversight and Roller latches are prohibited by CMS regulations further recommendations in all health care facilities. This STANDARD is not met as evidenced by: Based on observations, it was determined that the facility failed to maintain the corridor doors. The findings include: Observation on 8/1/11 at 8:41 AM, revealed the basement stairway door would not close and positively latch. This finding was acknowledged by the Administrator and verified by the Maintenance Supervisor at the exit conference on 8/1/11. K 020 NFPA 101 LIFE SAFETY CODE STANDARD

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility: If deficiencies are cited, an approved plan of correction is requisite to continued

K 020

FORM CMS-2567(02-99) Previous Versions Obsolete

LABORATORY DIRECTORS OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

DEPARTMENT OF HEALTH AND HL PRINTED: 08/08/2011 **N SERVICES** FORM APPROVED CENTERS FOR MEDICARE & MEDICAID SERVICES OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING 445047 08/01/2011 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 306 W DUE WEST AVE IMPERIAL GARDENS HEALTH AND REHABILITATION MADISON, TN 37115 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (X5) PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG COMPLETION CROSS-REFERENCED TO THE APPROPRIATE TAG DEFICIENCY) K 020 Continued From page 1 K 020 K 020 SS=E The hole in the ceiling around the Stairways, elevator shafts, light and ventilation chute in the basement was repaired by shafts, chutes, and other vertical openings the Maintenance Manager on 8/5/2011 between floors are enclosed with construction having a fire resistance rating of at least one The ceiling in the laundry chute room hour. An atrium may be used in accordance with 8.2.5.6. on the first floor was repaired on 19.3.1.1. 8/5/2011 by the Maintenance Manager. Both of the ceilings above have a fire resistance rating of at least 1 hour. This STANDARD is not met as evidenced by: Based on observations, it was determined that The Maintenance Manager will the facility failed to maintain the fire resistance monitor the laundry chute weekly X 4 rating in the laundry chute. then monthly X 3 (Attachment 15) The findings include: Results will be reviewed at the 1. Observation on 8/1/11 at 8:42 AM, revealed a monthly Q1 meeting for oversight and hole in the ceiling around the laundry chute in the further recommendations basement. 2. Observation on 8/1/11 at 10:02 AM, reveled a damaged ceiling in the laundry chute room on the first floor. These finding were acknowledged by the Administrator and verified by the Maintenance Supervisor at the exit conference on 8/1/11.

K 067

K 067

K 067

The exhaust fan in room 322 was adjusted on 8/1/2011. It fits tightly and is working effectively

An exhaust fan was placed in the biohazard room on 8/1/2011 making negative pressure.

FORM CMS-2567(02-99) Previous Versions Obsolote

specifications.

19.5.2.2

NFPA 101 LIFE SAFETY CODE STANDARD

in accordance with the manufacturer's

Heating, ventilating, and air conditioning comply

with the provisions of section 9.2 and are installed

19.5.2.1, 9.2, NFPA 90A.

Event ID: 125021

Facility ID: TN1912

If continuation sheet Page 2 of 4

DEPARTMENT OF HEALTH AND HUNN SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 08/08/2011 FORM APPROVED OMB NO. 0938-0391

OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING\_ 445047 08/01/2011 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 306 W DUE WEST AVE IMPERIAL GARDENS HEALTH AND REHABILITATION MADISON, TN 37115 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION PREFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL (X5) COMPLETION DATE PREFIX TAG REGULATORY OR LSC IDENTIFYING INFORMATION) (EACH CORRECTIVE ACTION SHOULD BE TAG CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY) Continued From page 2 K 067 The Maintenance Manager will monitor weekly X 4 then monthly X 3 This STANDARD is not met as evidenced by: (Attachment 15) Based on observations, it was determined that the facility failed to maintain the heating, ventilating, and air conditioning. Results will be reviewed at the monthly QI Meeting for oversight and The findings include: further recommendations Observation on 8/1/11 at 9:30 AM, revealed the exhaust fan in room 322 did not function properly and was loose in the ceiling. 2. Observation on 8/1/11 at 9:50 AM, revealed the bio hazard room in the connector corridor had positive pressure. These finding were acknowledged by the Administrator and verified by the Maintenance Supervisor at the exit conference on 8/1/11. K 130 NFPA 101 MISCELLANEOUS K 130 K 130 SS=D The helium tank in the Activity Office OTHER LSC DEFICIENCY NOT ON 2786 was secured in a stand on 8/1/2011. The Activity Manager will monitor weekly X 4, then monthly X 3 to ensure This STANDARD is not met as evidenced by: proper storage (Attachment 15) Compressed gas cylinders must be secured against falling. Results will be reviewed at the monthly Ol meeting for oversight and further Based on observations, it was determined that recommendations the facility failed to maintain proper storage of gas cylinders. The findings include: Observation on 8/1/11 at 9:12 AM, revealed a helium tank unsecured in the activities office.

DEPARTMENT OF HEALTH AND I. PRINTED: 08/08/2011 **AN SERVICES** CENTERS FOR MEDICARE & MEDICAID SERVICES FORM APPROVED OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: A. BUILDING COMPLETED 01 - MAIN BUILDING 01 B. WING 445047 08/01/2011 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE IMPERIAL GARDENS HEALTH AND REHABILITATION 306 W DUE WEST AVE MADISON, TN 37115 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION PREFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL (X5) COMPLETION PREFIX TAG REGULATORY OR LSC IDENTIFYING INFORMATION) (EACH CORRECTIVE ACTION SHOULD BE TAG CROSS-REFERENCED TO THE APPROPRIATE DATE DEFICIENCY) K 130 | Continued From page 3 K 130 This finding was acknowledged by the Administrator and verified by the Maintenance Supervisor at the exit conference on 8/1/11. K 147 NFPA 101 LIFE SAFETY CODE STANDARD K 147 K 147 SS=D The ground fault circuit interrupt Electrical wiring and equipment is in accordance with NFPA 70. National Electrical Code, 9.1.2 electrical outlet adjacent to the grill was fixed on 8/1/2011. The Maintenance Manager will monitor This STANDARD is not met as evidenced by: weekly X 4 then monthly X 3 to ensure Based on observations, it was determined that it is working appropriately the facility failed to maintain the electrical wiring (Attachment 15) and equipment. Results will be reviewed at the monthly The findings include: QI Meetings for oversight and further Observation on 8/1/11 at 9:01 AM, revealed the recommendations Ground Fault Circuit Interrupt electrical outlet adjacent to the grill in the kitchen did not work. This finding were acknowledged by the Administrator and verified by the Maintenance Supervisor at the exit conference on 8/1/11.